


Township Roads – Pavement Condition Rating (PCR)

Road Name: CEMETERY RD
Inspector: Jim Branch
Date: Apr 29, 2018
Last Maintenance Date: 1999
Last Maintenance Type: Paving

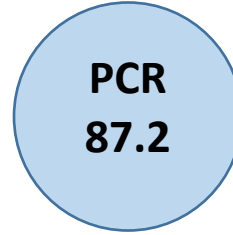

100-90	Very Good
89-75	Good
74-65	Fair
64-55	Fair to Poor
54-40	Poor
39-0	Very Poor

Distress Type	Distress Weight	Severity	Frequency	Deduct Points
Raveling:	10	None - 0	None - 0	
Bleeding:	5	None - 0	None - 0	
Patching:	5	Low - 0.3	Occassional - 0.6	0.9
Debonding / Potholes:	5	Low - 0.3	Occassional - 0.6	0.9
Rutting:	10	None - 0	None - 0	
Map Cracking:	5	Medium - 0.6	Frequent - 0.8	2.4
Base Failure:	10	None - 0	None - 0	
Settlements:	5	Low - 0.4	Occassional - 0.6	1.2
Transverse Cracks:	10	Medium - 0.7	Occassional - 0.5	3.5
Wheel Track Cracking:	15	None - 0	None - 0	
Longitudinal Cracking:	5	Low - 0.2	Occassional - 0.4	0.4
Edge Cracking:	5	High - 1	Frequent - 0.7	3.5
Pressure Damage Upheaval:	5	None - 0	None - 0	
Crack Sealing Deficiency:	5	None - 0	None - 0	
Total Deduct Points:				12.8
Total Structural Deduct Points:				7.4
PCR:				87.2

Notes:

Photo Documentation

Distress Type: Map Cracking



Photo Documentation

Distress Type: Debonding / Potholes



Photo Documentation

Distress Type: Edge Cracking



Photo Documentation

Distress Type: Settlements



Photo Documentation

Distress Type: Map Cracking



Photo Documentation

Distress Type: Edge Cracking



Photo Documentation

Distress Type: Map Cracking



Photo Documentation

Distress Type: Transverse Cracking



Photo Documentation

Distress Type: Settlements



Photo Documentation

Distress Type: Map Cracking



Photo Documentation

Distress Type: Transverse Cracking



Photo Documentation

Distress Type: Edge Cracking